

Combination Automat Wapo-Ex

Boil Out and Polymerisation Unit







Dear customer,

Thank you for choosing a product from the Wassermann range. Wassermann Dental-Maschinen incorporates the highest standards of quality and the latest technology. In order to enjoy maximum performance and years of trouble-free operation, please read this user manual carefully before you connect this device and start work, and operate the device according to the recommended guidelines. The operation safety and the functionality of this device can only be guaranteed if you follow both the general safety guidelines and the applying laws to prevent accidents as well as the precautions given in this user manual. We are not liable for any damages which occur due to inappropriate usage or faulty operation of this device.



Make sure that anyone using this device has read and understood this user manual.

Keep this user manual in a safe place where it can be referred to as required at any time.

 ϵ

The unit complies with the relevant EU guidelines.



The unit is subject to the EU guidelines 2012/19/EU (WEEE Directive).

Company address:

Wassermann Dental-Maschinen GmbH

Rudorffweg 15-17

21031 Hamburg, Germany

Phone: +49 (0)40 730 926 -20/ -24 Fax.: +49 (0)40 730 37 24

export@wassermann-dental.com

www.wassermann.hamburg



Contents

1 Features	4
2 Safety Symbols used in this Manual	5
3 Safety Guidelines	5
4 Responsibility for Operation or Damage	6
5 Application5	
6 Before Starting	
6.1 Transport	
6.2 Installation	
6.3 Storage	
7 Installation/ Start-up	
8 Operation	9
8.1 General Operating Instructions	9
8.2 Operation	
8.3 Setting Time and Temperature	11
8.3.1 For Scalding (button 2)	11
8.3.2 Conversion Table °C - °F	11
8.3.3 Polymerisation (Choice of 3 Times and 3 Temperatures)	12
8.3.4 Setting the Time	12
8.3.5 Setting the Temperature	13
8.4 Storing	14
8.5 Special Function: "Scalding during Polymerisation"	14
8.6 Manual Operation	14
9 Troubleshooting	15
10 Care and Maintenance	16
10.1 Cleaning	16
10.2 Maintenance	17
10.3 Repairs	17
10.4 Spare Parts	17
10.5 Service Hotline 0049 (0)40 730 926 -20/ -24	17
10.6 Scope of Delivery/ Accessories	18
10.7 Warranty	18
11 Technical Data	19
12 Disposing of the Unit	19
12.1 Information on Disposal for Countries within the EU	19
13 EU Declaration of Conformity	20



1 Features

The proven Wassermann Wapo-Ex combination automat, with an easy-to-read multifunction display, is an extremely compact piece of bench top equipment, which is used for scalding wax and for polymerisation. It can take 4 half-caps for scalding and/or 6 caps in a denture for polymerisation. A housing and chamber in stainless steel contribute to its long service life.

The unit has a low-water monitor to protect the heater, and for scalding small items, there is a recessed lid and a hand-held spray in non-heat-conducting plastic.

The special Wapo-Ex/ IVOCAP model has an automatic water-level regulator.

- Combined table automat for scalding and polymerisation; simultaneous applications possible (see chapter 8.5)
- Prompt switch between the two modes thanks to its separate compartments
- Capacity: 4 flask halves for scalding, 6 flasks for polymerisation
- Reproducible work processes via programmable scalding and polymerisation sequences
- Informative display, enables a variety of functions in applications
- Clock timer settings accurate to the minute and to a specific degree
- Visual and audible water level indicator
- Splash protection made of stainless steel
- Energy saving thermal insulation
- Integrated hand spray for manual scalding
- High quality construction, most parts made of stainless steel
- In factory setting the main polymerization process cuts in 90 minutes automatically at 95° C 90 minutes before the program ends - the choice of 3 times and 3 temperatures is possible as an option



2 Safety Symbols used in this Manual



Warning!

This is a warning of risk situations and dangers.

Failure to observe this warning could be life-threatening.

These warnings has to be observed.



Information!

This symbol draws your attention to specific features that has to be observed.

3 Safety Guidelines

Configuring and operating this equipment requires *precise knowledge* and *observance* of the instructions in this *user manual*. The equipment is designed only for its intended application.



WARNING:

Servicing and repairs should be carried out only by authorised specialists.

Disconnect the power plug before starting any maintenance work.



Make sure that the equipment is connected to the correct power source.



Risk of scalding!

Do not hold the hand spray by the nozzle or hose.

Do not point the spray at living creatures.

The water from the nozzle can be as hot as about 95°C, so should only be sprayed near the unit lid or the washbasin.



Wear <u>heat-resistant gloves</u> when working with th Wapo-Ex.



4 Responsibility for Operation or Damage

The responsibility for operating the device lies exclusively with the owner or user if said device is incorrectly serviced, maintained or altered by persons not employed by an authorised dealer or if the device is used in a manner contrary to its specified purpose. The unit has to be maintained and operated in accordance with this user manual. Wassermann Dental-Maschinen GmbH is not responsible for damage arising from the **nonobservance** of these instructions.

Warranty and responsibility provisions contained in the sales and supply conditions of Wassermann Dental-Maschinen GmbH are not extended by these instructions.

5 Application

The Wapo-Ex is used for scalding up to 4 half-caps and up to 6 caps for polymerisation. A divider in the trough creates two separate chambers. You can also scald small items using a hand spray.

Only use the device for this type of application.

6 Before Starting

6.1 Transport

Before transporting the unit, ensure that it has been unplugged from the power socket. Make sure that it is packed correctly in order to avoid accidental damage.

Be sure to check for any transport damage when unpacking the goods. Note down any damage if found.



6.2 Installation

Open the box, remove the packing materials, and carefully lift out the device and accessories. Check the included accessories.

The device has to stand horizontally on a steady and even surface.




Install the device in a place where it will not block the working area and the functionality (take the dimensions into account).



Do not install the unit outdoors or in places without proper ventilation.

Before start-up, be sure the device reaches room temperature.



6.3 Storage

The unit location is very important when it comes to workplace safety, even if it is only to be set up there for a short period. The room should be dry, well ventilated and vibration-free. An even temperature and wooden supports also help. The unit should not be stored or set up outdoors. If the unit is to be stored for an extended period, protect it from moisture and dust.



7 Installation/ Start-up



Before starting the unit, connect up the following:

 Use clips to attach the drain hose supplied firmly to the unit and arrange a suitable drainage system.

Finally, insert the power plug into the socket, making sure that the mains and the unit operate on the same voltage.

- Insert the filter white side down.
- Fill the unit with water (about 20 litres) at least up to the white plastic ring in the container.
- Turn on the main switch (green rocker switch).
- The unit immediately heats up to its default setting (65°C), or to the last stored scalding temperature.
- When the desired temperature has been reached, the yellow LED (9) goes out and the unit is ready for operation.



The Wapo-Ex has a dry-run protection device to prevent the heater burning out due to a lack of water (red LED). A warning signal also sounds while the program is running.

Make sure that the water level is always above the white plastic ring (in the container), otherwise the heater will cut out automatically and the red LED will flash.

If the unit is not to be used for an extended period, pull out the power plug.



8 Operation

8.1 General Operating Instructions

All instructions for using the unit, whether in verbal or written form, are based on our own experience and experimentation and can only be regarded as guidelines.



Warning: Risk of scalding!

Do not hold the hand spray by the nozzle or hose.

Do not point the spray at living creatures.

The water from the nozzle can be as hot as about 95°C, so should only be sprayed near the unit lid or the washbasin.



Wear <u>heat-resistant gloves</u> when working with th Wapo-Ex.


- The Wapo-Ex is ready for use when the temperature is above 60°C, that is, the pump starts operation once the set temperature has been reached. On addition there is a safety step: the heating stops automatically when the temperature of the heating is higher than 99 °C.
- The ball valve (top right on housing) needs to be set horizontal when scalding with the hand spray. To take the pressure off the hose and hand spray, always reset the valve to vertical when they are not being used.

Note: Each button has a built-in red LED. Start the program once the desired temperature has been reached.



8.2 Operation

- Turn on main switch (green rocker switch).
- The red water-level LED (10) should not come on or flash. If it does, check the water level or the water-level sensor.
- Choose Polymerisation or Scalding.
- Place prepared caps in unit.
- Set desired time and temperature for scalding (see 6.2.1).
- Set desired time and temperature for polymerisation (see 6.2.2).
- Use Start/Stop (7) to start the program.
- The yellow LED (9) comes on during heating.
- After the boiling out programm ends, a tone sounds and the heating and pump are switched off.
- After the polymerisation programm ends, the heating is switched off.

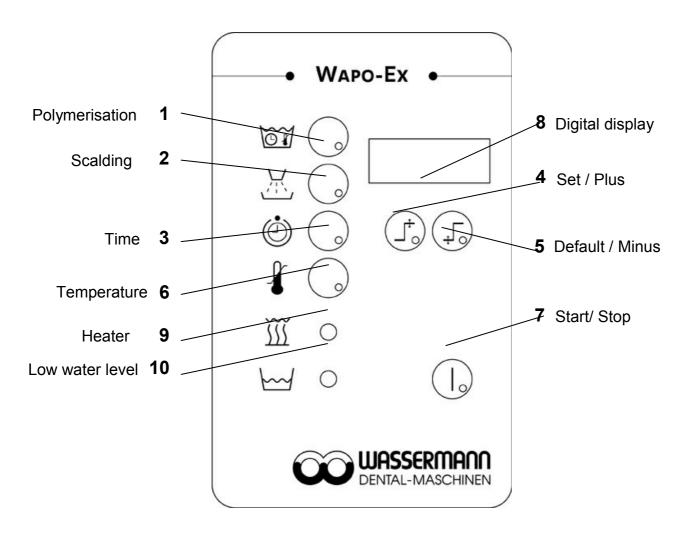



8.3 Setting Time and Temperature

8.3.1 For Scalding (button 2)

Setting the time:

- 1. Press Time (3).
- 2. Press Set (4).
- 3. Keep Time (3) pressed and set the desired time using Set (4) or Default (5).

Setting the temperature:

- 1. Press Temperature (6).
- 2. Press Set (4).
- 3. Keep Temperature (6) pressed and set the desired temperature using Default (5) and Set (4).

8.3.2 Conversion Table °C - °F

$$\vartheta_{\text{Celsius}} = (T_F - 32) / 1,8$$


100 °C = 212 °F
95 °C = 203 °F
90 °C = 194 °F
85 °C = 185 °F
80 °C = 176 °F
75 °C = 167 °F
70 °C = 158 °F
65 °C = 149 °F
60 °C = 140 °F



8.3.3 Polymerisation (Choice of 3 Times and 3 Temperatures)

The Polymerisation (1) and Set-Point (4) LEDs must be on, but not Start/Stop (7). Use the buttons as described below to set the function. This allows you to check and/or change stored values.


8.3.4 Setting the Time

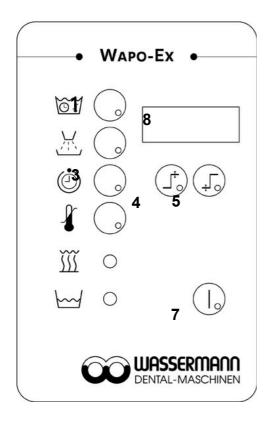

- 2. Store the value by simultaneously pressing Polymerisation (1) and Set-Point (4).
- For the second value, press and hold Time
 (3) again, then press Start/Stop (7) once. The second character on the display flashes.
 Follow the same sequence as above.
- The procedure is the same for the third display character. Each change needs to be stored.
- If Time (3) is pressed and held, and Start/Stop (7) pressed a fourth time, the total of the three individual times is displayed.
 Times assigned the value zero (0) are ignored.



8.3.5 Setting the Temperature

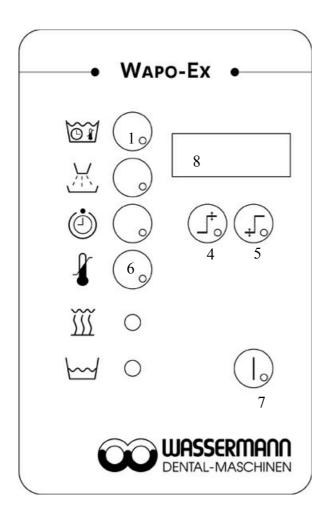

- Press and hold Temperature (6), then press Start/Stop (7) once.
 The first character on the display (8) flashes to indicate that the value can be changed by pressing Set-Point (4) or True Value (5) while Temperature (6) is held on.
 Release all three buttons to store the changed value.
- The value is stored by simultaneously pressing Polymerisation (1) and Set-Point (4).
- For the second value, press and hold Temperature (6), then press Start/Stop (7) once. The second character on the display flashes. Follow the same sequence as above.
- The procedure is the same for the third display character. Each change needs to be stored.
- If Temperature (6) is pressed and held, and Start/Stop (7) pressed a fourth time, the first of the three individual temperatures is displayed.



8.4 Storing

Individual set values can be stored by simultaneously pressing Scalding (2) or Polymerisation (1) <u>and</u> Set (4). A "**YES**" on the display confirms that the values have been stored. As each new value is stored, the previous value is overwritten.

Warning: Pressing Scalding (2) or Polymerisation (1) **and** Default (5) resets the Wassermann default values. Storing the value using Polymerisation (1) and Plus (4) is confirmed by a "**YES**".

Basic setting polymerisation		Basic setting scalding	
Time	Temperature	Time	Temperature
6:30 h	70°C	15 min	65°C
0:00 h	0°C		
1:30 h	95°C		

8.5 Special Function: "Scalding during Polymerisation"

Scalding is possible while the polymerisation process is underway. The last stored scalding time is used, not at the last stored scalding temperature, but at the default temperature for the polymerisation process.

Scalding is started by pressing Scalding (2). The scalding process can be stopped by pressing Scalding (2) again.

<u>Warning</u>: All operations, including polymerisation, are stopped if you press Start / Stop (7)!

8.6 Manual Operation

Once the unit is ready for use, you can, at any time, activate the hand spray by turning the ball valve (horizontal). Settings should be as described under 6.2. When you have finished, always return the ball valve to its original position (vertical).



9 Troubleshooting

Fault	Cause	Solution
Wapo-Ex does not heat up	Dirty level sensor	Clean level sensor
	Water level too low	Add water
Water-level LED comes on and warning tone sounds	Dirty level sensor	Clean level sensor
	Water level too low	Add water until red LED goes out and tone stops
Water pump inoperative	Operating or set temperature not yet reached	Heat to operating temperature (min. 60°C) or set temperature
Multifunction display shows A	Water-temperature above 100°C (A3 means 103 °C) -faulty temperature sensor -faulty control board	Turn off the water supply, switch off the unit completely, contact service
Multifunction display shows F 1	Short-circuit: Faulty electrial component	Turn off the water supply, switch off the unit completely, contact service
Multifunction display shows F 2	Faulty temperature sensor	Turn off the water supply, switch off the unit completely, contact service



If the above recommendations do not solve the problem, contact your dental depot or our service department.



10 Care and Maintenance

10.1 Cleaning



Disconnect the power plug before starting any maintenance work.

The identification plate has always to be kept in easily legible condition and has not to be removed.



Remove external dirt from time to time with some form of cold cleaner.

Use only cold cleaners to avoid damaging the paintwork or removing the lettering. The outside of the unit and fittings are best cleaned with a sponge or soft cloth and mild detergent.

The equipment should be cleaned at regular intervals to ensure trouble-free operation.

At least:

Once a week

- Change water, adding Wax–Ex.
- Quantity: approx. 4 ccm/1 litre water, corresponding to approx. 90 110g per 20 litres.
- Clean level sensor (white plastic ring) with nailbrush or similar.

Every 2 weeks

Change filter (white side down).

Every 4 weeks

- Clean unit with Kalk–Ex.
- Quantity: approx. 5ccm/1 k litre water, corresponding to approx. 170 220g of Kalk-Ex per 20 litres.

If heavy lime deposit, increase quantity appropriately!





Warning: Do not use materials containing solvents to dissolve wax, as this will attack the unit's rubber components.

Warning: Let Kalk-Ex work for a <u>maximum 12 hours</u>.

Drain solution and rinse thoroughly.

To change the filter and clean the level sensor (white ring), first remove the cap containers. The perforated plate can then be taken out and you can remove the flat filter. When inserting a new one, make sure that the white side is face down and that the filter fits under the raised edge of the base plate. The base plate is easily removed, giving ready access to the level sensor and the heater coil. Re-insert the base plate with its raised edges facing upwards.

10.2 Maintenance

The unit does not need any special maintenance. Just make sure it is clean and free of lime build-up.

10.3 Repairs



Servicing or repairs to the unit has only to be carried out by qualified technicians. Only original spare parts are to be used. Responsibility for the product is voided if unauthorised persons alter it or if inappropriate components are installed.

10.4 Spare Parts

If necessary please contact our service hotline phone.

10.5 Service Hotline 0049 (0)40 730 926 -20/ -24



10.6 Scope of Delivery/ Accessories

Included parts	Item no.
Service set (10 filter mats, 1 L lime remover, 2 L wax remover)	170020
Discharge hose, PVC-hose 19 x 4 (3/4") -1.5 m	320030
Hose clip Ø 20-32 x 12.2	322017

Accessories	Item no.
Service set (10 filter mats, 1 L lime remover, 2 L wax remover)	170020
Mobile stand	170100
Discharge hose, PVC-hose 19 x 4 (3/4") - per meter	320030

10.7 Warranty



The warranty period for our equipment is 12 months. If faults occur within the warranty period, contact your dental depot or get in touch directly with our service department.

Your equipment should only be operated in perfect condition. If faults occur which could harm operators or third parties, the unit should not be used until it has been fixed.

This warranty does not cover damage caused by improper use, external mechanical causes, transport damage or interference with the unit by unauthorized persons.



11 Technical Data

Wapo-Ex	Artikel Nr.: 170996
Voltage	220–240 V / 50/60 Hz
Power consumption	9 A
Output	2000 W
WxHxD	550 x 570 x 400 mm
Weight	35,5 kg
Water capacity	approx. 20 I

Other voltages on request.

The noise level of the unit amounts to \leq 70 dB (A).



Technical changes reserved.

12 Disposing of the Unit

The unit has to be disposed by an authorized recycling operation. The selected company has to be informed of all possibly health-hazardous residues in the unit.

12.1 Information on Disposal for Countries within the EU



To conserve and protect the environment, prevent environmental pollution and improve the recycling of raw materials, the European Commission adopted a directive that requires the manufacturer to accept the return of electrical and electronic units for proper disposal or recycling.

Within the European Union units with this symbol should not therefore be disposed of in unsorted domestic waste.

For more information regarding proper disposal please apply at your local authoritie.



Boil Out and

Polymerisation

Unit for dental

Item no. 170996

applications

13 **EU Declaration of Conformity**

in accordance with 2014/35/EU (Low Voltage Directive) and 2014/30/EU (Electromagnetic Compatibility Directive) and 2006/42/EC (Machinery Directive) and 2011/65/EU (RoHS Directive)

Product description:

Manufacturer: WASSERMANN

Dental-Maschinen GmbH

Rudorffweg 15-17 21031 Hamburg

Germany

Model: Wapo-Ex

Applicable DIN EN 61010-1 standards:

> DIN 45635-1 DIN EN 60335-1

DIN EN 61000-6-3 DIN EN 61000-6-1

Hiermit wird bestätigt, dass die oben bezeichnete Maschine den genannten EU-Richtlinien entspricht. Diese Erklärung wird ungültig, falls die Maschine ohne unsere Zustimmung verändert wird.

This is to confirm that the above mentioned machine complies with the described EU guidelines. This declaration becomes invalid if the machine is modified without our approval.

Cette machine est conforme aux normes en vigueur d'Union européenne. Cet avis est nul et non avenant si cette machine est modifiée sans notre accord.

Esta máquina, anteriormente mencionada, cumple con los limites requeridos por el reglamento UE. Ahora bien, esta declaración quedará invalidada en caso de realizar modificaciones al aparato sin nuestra aprobación.

Hiermee wordt bevestigd dat bovengenoemde machine voldoet aan de voorgeschreven EU normen. Deze verklaring verliest geldigheid als er zonder onze uitdrukkelijke toestemming wijzigen aan de machine worden aangebracht.

Place, date: Hamburg, 2017-07-07 Company stamp:

Signature:

Wilfried Wassermann (Managing Director)



NIOtae:	
INULUS.	





